




Exhaust Systems Engine Mounts Carb Air Boxes

Shrouds • Seats • Piston • Turbine • Radial • Vintage • And More...



BEECHCRAFT BARON 55/58 WITH 2.5" ATTACHED TAILPIPE

Item	Part Number	Description
1	96-950002-33	STACK RIGHT HAND FWD CYL #5
2	96-950002-31	STACK RIGHT HAND CTR CYL #3
3	96-950002-9	STACK LEFT HAND FWD CYL #6
4	96-950002-7	STACK LEFT HAND CTR CYL #4
5	96-950002-47	RISER STUB CYL #1 & #2
6	96-950002-57	TAILPIPE RE INBOARD
7	96-950002-61	TAILPIPE RE OUTBOARD
7	96-324101-2	TAILPIPE RE OUTBOARD WITH EGT PROB
8	96-950002-59	TAILPIPE LE INBOARD
8	96-324101-1	TAILPIPE LE INBOARD WITH EGT PROB
9	96-950002-55	TAILPIPE LE OUTBOARD
-	628260	GASKET
-	96-910005-75	ENGINE MOUNT SN ^{TC 1608} and on
-	J-9613-5	SHOCK MOUNT
-	96-910010-61	ENGINE MOUNT
-	96-910010-67	ENGINE MOUNT
-	96-910010-85	ENGINE MOUNT
-	J-10778-16	SHOCK MOUNT
-	VARIOUS	SEAT BASE

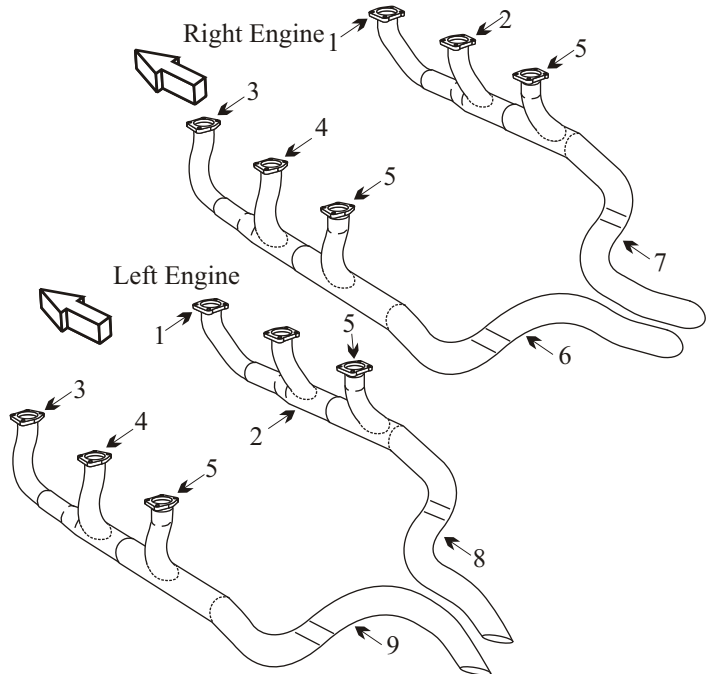

- Inspect joints for freedom of movement and distortion.
- Inspect tailpipe for thinning and internal corrosion.
- Slip fit stacks should be ordered as a complete assembly to ensure good joint integrity with smooth slip fits.

AD 91-15-20

Beech C55/D55/E55

Applies to S/N TC350 and S/N's TE-1 thru TE-1201

Beech 58/58A

Applies to S/N's TH-1 thru TH-1610.

Inspect engine mount for cracks.

Inspection required every 100 hrs of operation till mount repaired with Beech Kit 58-9007-1S or replaced with P/N 96-910010-67 or 96-910010-85.

(toll free) 1-888-388-8803 1-780-447-5955 Fax: 1-780-447-5980
 sales@acornwelding.com parts@acornwelding.com www.acornwelding.com