



# Exhaust Systems Engine Mounts Carb Air Boxes


Shrouds • Seats • Piston • Turbine • Radial • Vintage • And More...



## CESSNA SKYHAWK 172R 172R SN 80001 AND ON CESSNA SKYHAWK 172S 172S SN 58001 AND ON

Item	Part Number	Description
1	9954100-9	MUFFLER (INCONEL)
2	9954100-3	SHROUD
3	9954100-7	RISER RIGHT FRONT (1754010-1)
4	9954100-4	RISER RIGHT REAR (1754007-1)
5	9954100-6	RISER LEFT FRONT (1754009-3)
6	9954100-5	RISER LEFT REAR (1754008-3)
7	1555014-2	CLAMP HALF
-	77611	GASKET
-	0551023-25	ENGINE MOUNT
-	J-23502-1	SHOCK MOUNT
-	0514214-1	SEAT BASE PILOT & CO-PILOT
8	0550384-13	INDUCTION AIR BOX
9	0550362-3	INDUCTION ELBOW
10	S3297-1	DUCT

**Cessna 172R**  
AD 98-02-05  
Applies to S/N's 17280001 thru 17280305 with Aeroquip muffler P/N 00624-NH4000011-10 and 71379 0554011-2  
Mufflers stamped with "PT" or "PTT" are not Aeroquip.  
Aeroquip muffler must be replaced.

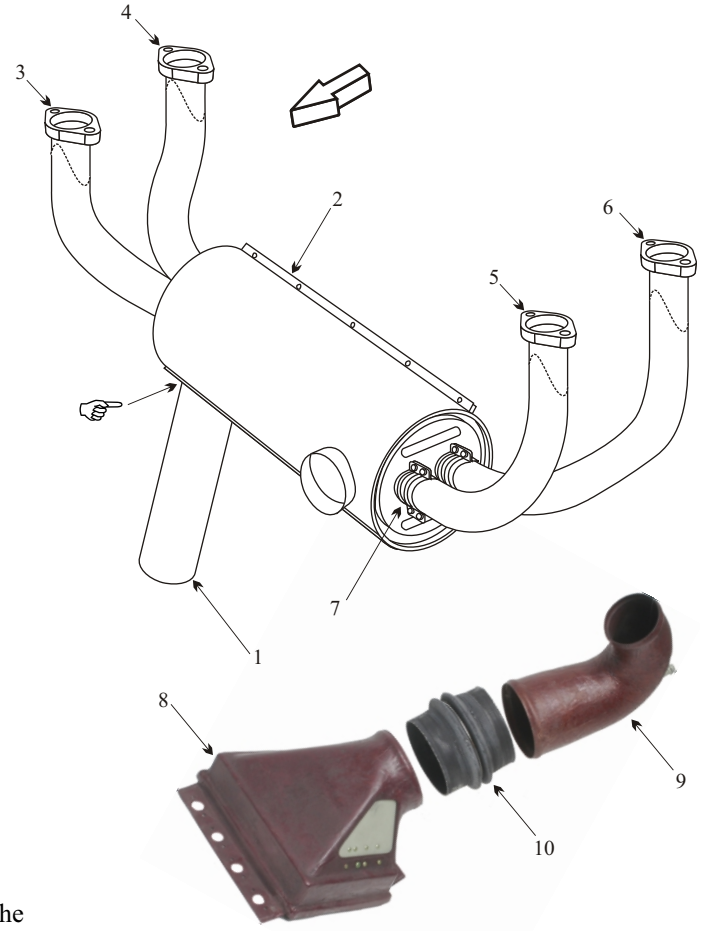

👉 Inspect muffler where tailpipe attaches. The muffler usually cracks from the inside in this area.

- This muffler does not require flame tubes or cones.
- Inspect riser stacks at the flange reinforcement doublers, at the weld edges, and flange base for cracks. The inspection is more successful if the carbon residue is removed from inside the stack.

(toll free) 1-888-388-8803 1-780-447-5955 Fax: 1-780-447-5980  
sales@acornwelding.com parts@acornwelding.com www.acornwelding.com